

SITE SURVEY REPORT

Kitchen Extract Cleaning Record (TR19 Grease)

Prepared for	The Spice House
Date	5 Oct 2026
Site	The Spice House
Prepared by	R. Patel

FORM

Kitchen Extract Cleaning Record (TR19 Grease)

1. System

Project	The Spice House: kitchen extract clean to TR19 Grease (completed example)
Client	The Spice House
Site	The Spice House
Site address	High Street, Leicester
Clean date	5 Oct 2026
Time	23:00
Technician	R. Patel
Company	Fresh Duct Ltd
System and location (canopy reference and duct route)	Main canopy over the tandoor and range, duct to the roof fan
Kitchen use	Heavy (12 to 16 hours a day)

TR19 Grease minimum: clean every 3 months.

Previous clean	2 Jul 2026
Days since the previous clean	95
Months since the previous clean	3.1
TR19 minimum frequency (months)	3
Interval against the minimum	Longer

The time since the previous clean is longer than the TR19 Grease minimum frequency for this usage. Record it in the post-clean report and agree the schedule with the client.

2. Clean

Cleaned	Canopy, Filters, Plenum, Ductwork, Fan, Discharge
Access panels used	5
Areas not cleaned and why	None. Roof fan inlet spot cleaned first (520 microns).

Deposit thickness tests 1: Canopy plenum behind the filters

Test position	Canopy plenum behind the filters
Before (microns)	340
After (microns)	30

Deposit thickness tests 2: Duct riser at first floor access panel

Test position	Duct riser at first floor access panel
Before (microns)	290
After (microns)	40


Deposit thickness tests 3: Roof fan inlet

Test position	Roof fan inlet
Before (microns)	520
After (microns)	50
Test positions	3
Mean before (microns)	383
Highest before (microns)	520
Mean after (microns)	40

A reading of 500 microns or more before the clean. TR19 Grease: grease deposits should not exceed a mean of 200 microns between cleans, and 500 microns or more needs immediate spot cleaning.

The mean before this clean is over 200 microns. TR19 Grease limits the mean to 200 microns between cleans, so a shorter cleaning interval may be needed.

Before photos

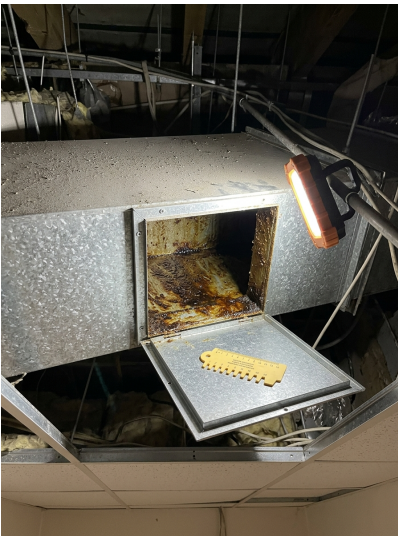

Illustrative stamp: 5 Oct 2026 09:15 BST · sample GPS 51.5074, -0.1278. Original photo capture date/location unverified.

After photos



3. Post-clean report

Defects found (damaged ductwork, missing access panels, fire dampers)

One fire damper on the riser has no access panel; quoted to fit one. Last clean was about 3.1 months ago against the 3-month minimum for heavy use: next clean booked for early January.

Defects recorded

0

Urgent

0

BESA says many insurance policies require cleaning to TR19 Grease. The post-clean report includes a hygiene certificate with the date of the clean, the system location and the name of the competent technician.

Hygiene certificate or report reference FD-2026-1043

Next clean due 5 Jan 2027

Days to the next clean 93

Site manager name V. Shah, owner

Site manager signature

V. Shah, owner

Completed by R. Patel

Signature

R. Patel